



**Cobra Motorcycle Mfg.**


240 Uran street  
Hillsdale, MI 49242

(517) 437-9100 phone  
(517) 437-9101 fax

## TSB2108 JR & OI Radiator Cap

July 9, 2008

The radiator cap on the JR/OI radiators (Cobra part numbers; radiator only ECMU0225, or kits EKMU0007/EKMU0008) has a faulty pressure release point. Until the vender supplies us with properly functioning caps, the fix is to install a small shim under the sealing gasket on the cap (figure 1).

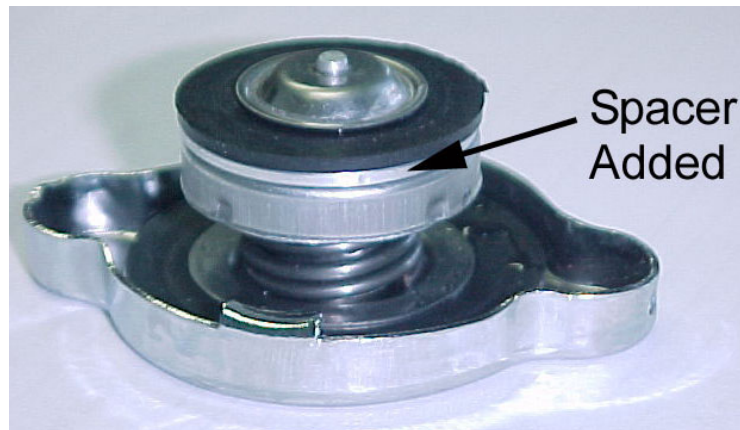

Cobra will send a spacer (ECMU0555) to all OI / JR customers with silver radiators. Assembly instructions are listed below. If the customer is uncomfortable with the installation process, they may send the cap to their dealer or back to the factory for installation.

### Spacer installation

1. Start the process by removing the rubber gasket. Stretch it to elongate the center hole (yes it will stretch a long way).





# Technical Service Bulletin

## Cobra Motorcycle Mfg.


240 Uran street  
Hillsdale, MI 49242

(517) 437-9100 phone  
(517) 437-9101 fax

2. Once the gasket is stretched sufficiently, pull it back over the center crown to remove.



3. With the rubber gasket removed, place the spacer centered crown on the cap.

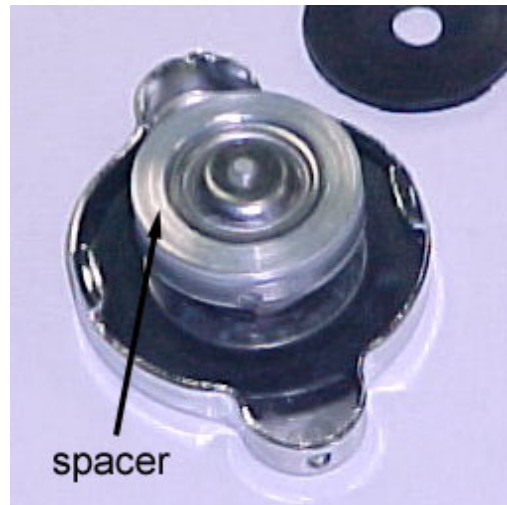

4. With the spacer in place, lightly pry up the center crown with a small screwdriver .





## Technical Service Bulletin

### Cobra Motorcycle Mfg.

240 Uran street  
Hillsdale, MI 49242

(517) 437-9100 phone  
(517) 437-9101 fax

5. With the center lifted, stretch the gasket and work it's hole around the center crown.



6. When completed it should look like this.

